TOP SIGHT

OUT57042

25X1

Les 22% and a contract of the contract of the

T O P S E C R E T Ø3ØØ51Z	1965 NOV	3	01	02 Z	
PRIORITY 5783		••			25 X ′
IDEALIST					
ATTENTION:				*	25 X ′
SUBJECT: EVALUATION OF MISSION C545C					
1. CAMERA B 12 WAS USED IN MISSION C545C FLOWN ON 1965. PROCESSING WAS ACCOMPLISHED IN THE FIELD.	2Ø OCTO	BER			
2. ORIGINAL NEGATIVE: .					
A. THE EXPOSURE WAS ADEQUATE AND THE RESOLUTION	IS GOOD	•		ļ	4
B. 9R SIDE: EDGE FOG IS INTERMITTENT ALONG BOTH	EDGES				
THROUGHOUT THE MISSION. MINOR INBOARD ROLLER CHATTER	IS OCCA	SIO	NALLY	,	
PRESENT. FRAME 1330 WAS TORN DURING THE INITIAL BREAK	DOWN PR	OCEI	URE.	10V 40CF	
AND WAS REPAIRED WITH TAPE. THERE IS A MANUFACTURING				1BUT1911	7
FRAME 933.			Cy No.	Office	•
C. 9L SIDE: FOG CAUSED BY STATIC DISCHARGES IS	PRESENT	I N	ER2	File OS	
MITTENTLY ALONG THE INBOARD EDGE. WAVERING PLUS DENSI				SEC BR	
GENERALLY PARALLEL TO THE MAJOR AXIS OF THE FILM ARE P				P & DS CSD	
				IPD PD	,
MITTENTLY NEAR THE INBOARD EDGE ON THE LAST 50 PERCENT	Ur IHE	MI	SION	PSD	
STAINS ARE PRESENT INTERMITTENTLY ON FRAMES 578 THROUG	H 764.	TH	34	PSD-ICB TID	
STAINS ARE ON THE EMULSION SIDE OF THE FILM AND APPEAR	TO HAV	E BE	EN	IAD	
CAUSED BY A CONTAMINATION OF THE FILM PRIOR TO DEVELOP	MENT.	IN		PAG	
SOME AREAS OF THE STAINS THE SILVER HAS BEEN REDUCED F	_			DIAXX-4	<u> </u>
				SPAD NSA-LO	
SION AND NO IMAGE EXISTS. THE STAINS ARE ORIENTED ALO	NG THE			DIA-AP	1
LONGITUDINAL AXIS OF THE FILM AND ARE USUALLY CENTERED	ABOUT	2.0	•	<u> </u>	+
FROM THE OUTBOARD EDGE.			I	Adyance co Sanitized	PY.

TOP SECRET

-2-

- D. BOTH SIDES: PINHOLES AND BLISTERS ARE MINOR AND INTER-MITTENT THROUGHOUT THE FILM OF BOTH SIDES OF THE MISSION. THE TITLING ON BOTH SIDES BEGAN AT 000 AND ENDED AT 1640.
 - E. THERE WERE NO APPARENT CAMERA MALFUNCTIONS DURING THE MISSION.
 - 3. POSITIVE:
 - A. THE PI SUITABILITY IS GOOD.
 - B. PRINTING AND PROCESSING WAS GOOD.
- C. CLOUDS OBSCURE OR DEGRADE APPROXIMATELY 65 PERCENT OF THE MISSION.

TOPSECRET

-- END OF MESSAGE--